

Potentiometer Converter KFD2-PT2-Ex1-5

- 1-channel isolated barrier
- 24 V DC supply (Power Rail)
- Potentiometer input
- Current output 4 mA ... 20 mA
- Lead resistance compensation adjustment
- Accuracy 0.05 %














Function

This isolated barrier is used for intrinsic safety applications. It provides the source voltage to a potentiometer and transfers its wiper position from hazardous areas to safe areas. It then converts the signal to a 4 mA ... 20mA current output.

The unit can be used in a 3-, 4-, or 5-wire configuration depending on the required measurement accuracy. Terminals 2 and 5 are used as the sense line for the potentiometer lead resistance compensation in a 5-wire configuration.

The barrier's potentiometer can be used to compensate for lead resistance up to 5 % of the hazardous area potentiometer value.

Connection

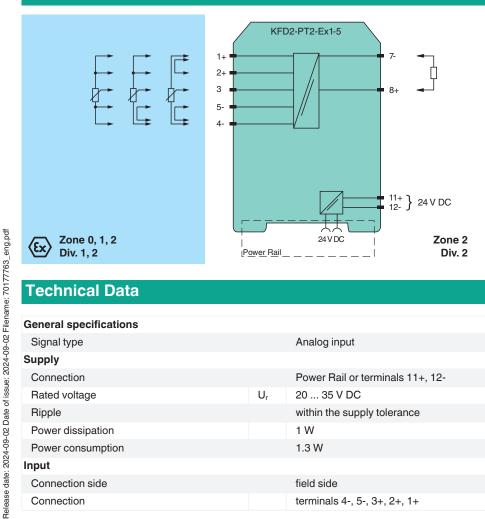

Technical Data

General specifications		
Signal type		Analog input
Supply		
Connection		Power Rail or terminals 11+, 12-
Rated voltage	U _r	20 35 V DC
Ripple		within the supply tolerance
Power dissipation		1 W
Power consumption		1.3 W
Input		
Connection side		field side
Connection		terminals 4-, 5-, 3+, 2+, 1+

Technical Data

Potentiometer 3-, 4-, 5-wire technology Types of measuring 800 Ω to 100 kΩ Nominal resistance Supply voltage approx. 4.7 V Lead resistance 5 % of the potentiometer resistance (adjustable) Output Connection side control side Connection terminals 7-, 8+ 4 ... 20 mA, load ≤1 kΩ Current output **Transfer characteristics** Accuracy 0.05 % Deviation ± 10 µA Linearity Influence of ambient temperature ≤ 1 µA/K Rise time 10 to 90 % \leq 8 ms; 10 to 90 % within 1 % of span \leq 25 ms **Galvanic** isolation Output/power supply functional insulation, rated insulation voltage 50 V AC Indicators/settings Control elements potentiometer Configuration via potentiometer **Directive conformity** Electromagnetic compatibility Directive 2014/30/EU EN 61326-1:2013 (industrial locations) Conformity NE 21:2012 Electromagnetic compatibility Degree of protection IEC 60529:2001 Protection against electrical shock UL 61010-1 **Ambient conditions** Ambient temperature -20 ... 60 °C (-4 ... 140 °F) Mechanical specifications Degree of protection IP20 Connection screw terminals Mass approx. 120 g 20 x 107 x 115 mm (0.8 x 4.2 x 4.5 inch) (W x H x D), housing type B1 Dimensions on 35 mm DIN mounting rail acc. to EN 60715:2001 Mounting

Data for application in connection with h	nazardous areas
EU-type examination certificate	BAS 00 ATEX 7171


EU-type examination certificate		BAS 00 ATEX 7171
Marking		
Voltage	U_{\circ}	10.4 V DC
Current	Io	31.4 mA
Power	Po	82 mW
Supply		
Maximum safe voltage	U_{m}	250 V (Attention! The rated voltage can be lower.)
Output		
Maximum safe voltage	U_{m}	250 V (Attention! The rated voltage can be lower.)
Certificate		TÜV 02 ATEX 1797 X
Marking		© II 3G Ex nA II T4
Galvanic isolation		
Input/Output		safe electrical isolation acc. to IEC/EN 60079-11, voltage peak value 375 V
Input/power supply		safe electrical isolation acc. to IEC/EN 60079-11, voltage peak value 375 V
Directive conformity		
Directive 2014/34/EU		EN IEC 60079-0:2018+AC:2020 , EN 60079-11:2012 , EN 60079-15:2010
International approvals		



Technical Data	
FM approval	
Control drawing	116-0129
UL approval	
Control drawing	116-0173 (cULus)
IECEx approval	
IECEx certificate	IECEx BAS 10.0060 IECEx BAS 10.0061X
IECEx marking	[Ex ia Ga] IIC, [Ex ia Da] IIIC, [Ex ia Ma] I Ex ec IIC T4 Gc
General information	
Supplementary information	Observe the certificates, declarations of conformity, instruction manuals, and manuals where applicable. For information see www.pepperl-fuchs.com.

Assembly

Front view

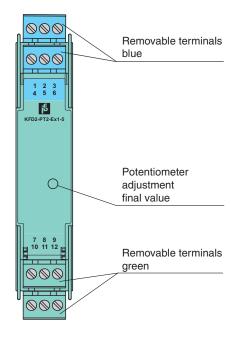

Release date: 2024-09-02 Date of issue: 2024-09-02 Filename: 70177763_eng.pdf

Application

Jumpers must be used on terminals 1, 2 and 4, 5 in 3-wire configurations. A jumper must be used between terminals 4 and 5 in 4-wire connections. In the 5-wire mode of operation, the potentiometer voltage is measured at terminals 2 and 5 and automatically readjusted.

The front side potentiometer can be used to compensate for lead resistances up to 5 % of the potentiometer value. During adjustment, the potentiometer is set to 100 % of its value and the output signal is adjusted to 100 % of the required value. This adjustment can be repeated setting the potentiometer to 0 %.